

# STEINER

## TRACTOR PARTS, INC.

1660 S M13, LENNON, MI 48449

Fax: 810.621.3099 Phone: 810.621.3000

[jr@steinertractor.com](mailto:jr@steinertractor.com)

2-7-09

MEMO

CATALOG CORRECTIONS,

PLEASE MAKE THESE IMPORTANT CHANGES TO STOP MISORDERS.....

PG #279, JDS744 DOESN'T FIT 420, DOES FIT 330 & 430

PG#241 JDS869 & JDS870 ALSO FITS 3010 DSL SN# 6644-UP

PG#172 IHS184 HOSE KIT DOESN'T FIT 300 OR 350

PG#119 ADD FDS310 DISTRIBUTOR SHAFT, FITS 9N, 2N EARLY 8N W/FRT MT DIST.  
(IT WAS LEFT OUT)

PG#300 JDS384 IS A SHIELD NOT THE CASTING, ALSO #JDS388 IS THE CASTING,  
NOT THE SHIELD, (PICTURES WERE REVERSED)

PG#387 OLS048 MUFFLER ONLY FITS SUPERS 66,77,88

PG#166 IHS574 CARB KIT FITS ZENITH (NOT IH) CARBS ALSO REPLACES# "S  
6392,21271DB,20590DA,21950DE,29472D,37449D, THIS KIT ALSO FITS F-30,W-30,

PG#50 WHS027 WONT FIT ALLIS CHALMERS TRACTORS

PG#287 IHS685 NUT WONT FIT 1010,2010

PG#285 JDS560,JDS562, WONT FIT 1010 ROWCROP UTILITY, SPECIAL ROWCROP  
UTILITY OR ROWCROP

PG#363 #MMS009 WONT FIT M670 OR SUPER M670

PG#212 #IHS343 WONT FIT 460, THEY ONLY FIT 560 & 660 IF THEY ARE LATE SN#'S  
FITS F-560 SN#59010-UP, I-560 SN#5521-UP, I-660 SN#6873-UP

PG#275 #JDS1001, DOESN'T FIT 6030 (EVEN THOUGH THE JD PARTS# IS THE SAME)

.....JR

# STEINER

## TRACTOR PARTS, INC.

1660 S M13, LENNON, MI 48449  
Fax: 810.621.3099 Phone: 810.621.3000  
[jr@steinertractor.com](mailto:jr@steinertractor.com)

11-20-08

09' CATALOG CORRECTIONS

PG#28 #ACS324 STARTER NOSE ALSO FITS WD

PG#283 #JDS021 TAKE OUT OF APPLICATIONS A,AR,AO, & G, TAKEOUT REPLACES# F195 & AF1247R, (WE NOW HAVE A NEW# JDS1017 THAT IS CORRECT FOR THE A&G

PG#49,221,302 & 381 #WHS045 WHEEL SHOULD SAY 8" X 16" (NOT 6 X 16)

PG#251 #FDS275 GAUGE CHANGE THE SENDING UNIT # TO #RE68351(NOT RE68341)

PG# 284 #JDS887 CLUTCH BOLT DOESN'T FIT B SN#60,000-UP

PG#173 #IHS898 WATER PUMP ALSO REPLACES# 367683R91

PG#391 ADD OIL FILTER #ABC006 FITS OLIVER 60

PG#196 #IHS448 HOOD BOLT THREAD SIZE IS 5/16X24

PG #19 ADD #ACS322 OIL PUMP KIT FITS AC G ,(THESE DIDN'T MAKE THE FINAL COPY)

PG#318 ADD #ACS322 OIL PUMP<sup>KIT</sup> FITS MH PONY

PG#337 FRONT EMBLEM FOR 35 MF (THIRD ONE DOWN) ADD ORDER# MFS103

PG#214 #IHS356 FENDER DOESN'T FIT 404 (#IHS357 & IHS358 WILL BOLT ON BUT DOESN'T LOOK LIKE ORIGINAL)

PG#214 #IHS359 FENDER U-BOLT ALSO FITS 240 & 404

PG#'S 184,262,331,370,397 #ABC348 HOT COIL ADD TO DESCRIPTION, MUST USE WITH #ABC366 RESISTER

PG#179 #IHS893 WIRE HARNESS CHANGE TO 5 MAIN WIRES (11 TOTAL) REPLACES#  
351235R91

PG#179 #IHS895 WIRE HARNESS CHANGE TO 7 MAIN WIRES (13 TOTAL) REPLACES#  
354252R91

PG#179 #IHS891 WIRE HARNESS CHANGE TO 8 MAIN WIRES (15 TOTAL) REPLACES#  
363507R91

IHS895 & IHS891 HARNESS INTERCHANGE. THE ONLY DIFFERENCE IS  
#IHS891 HAS 2 SEPARATE WIRES FOR HEADLITES & THE IHS895 HAS A SINGLE WIRE  
TO THE HEADLITES

PG#225 #IHS236 DWBR CLEVICE WONT FIT TRACTORS WITH FAST HITCH (PIN  
SPACING FOR #IHS236 IS 3 7/8" C-C)

.....JR

# STEINER

## TRACTOR PARTS, INC.

1660 S M13, LENNON, MI 48449

Fax: 810.621.3099 Phone: 810.621.3000

[jr@steinertractor.com](mailto:jr@steinertractor.com)

2009 CATALOG CORRECTIONS.....10-31-08

PG #30 #ACS110 TUNEUP, DELETE WD45, CHANGE D15 & D17 TO EARLY D15 & EARLY D17 (REASON=THE SPARK PLUGS ARE DIFF.)

PG#246 #ABC416 GASKET DOESN'T FIT 2010,1020,1530,OR 300 IND, FOR THESE APPLICATIONS USE #ABC424 (THE NEXT GASKET DOWN)

PG#285 #JDS586 SHIFT KNOB ALSO FITS `R`

PG#253 #JDS786 TACH CABLE DOESN'T FIT 620 (USE JDS777 NEXT CABLE DOWN)  
.....JR